

2005-08 ACCESSORIES AND EQUIPMENT

Horns - RL

COMPONENT LOCATION INDEX

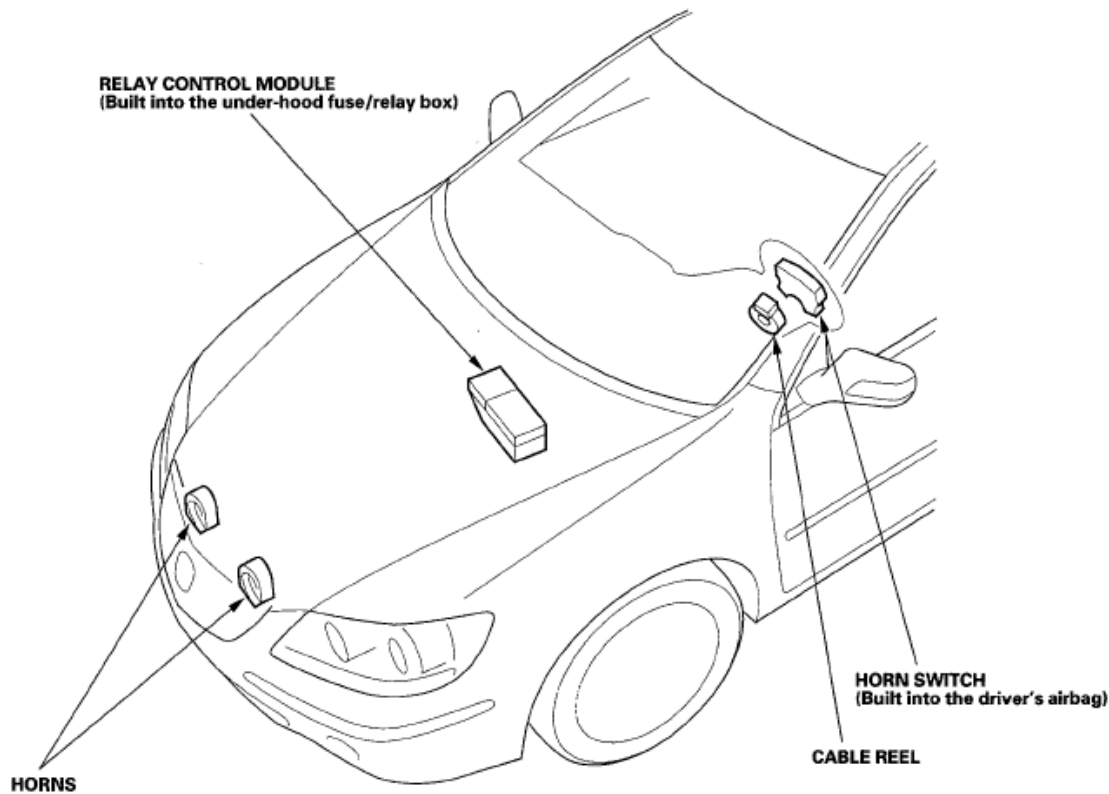


Fig. 1: Identifying Location Of Horns And Related Components
Courtesy of AMERICAN HONDA MOTOR CO., INC.

CIRCUIT DIAGRAM



1. Remove the upper grille (see **UPPER GRILLE REPLACEMENT**).
2. Disconnect the 1P connector (A) from each horn (B).

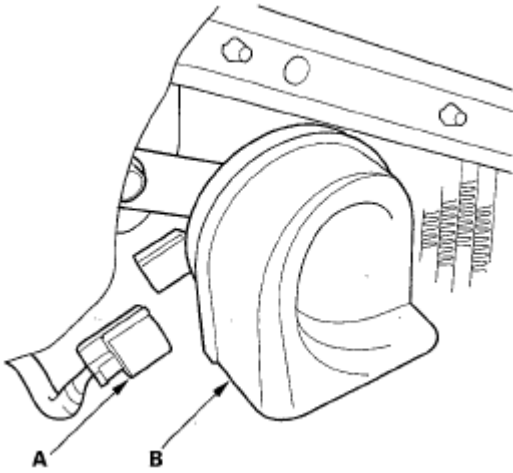


Fig. 3: Identifying Horn And 1P Connector
Courtesy of AMERICAN HONDA MOTOR CO., INC.

3. Test the horn by connecting battery power to the terminal (A) and grounding the bracket (B). The horn should sound.

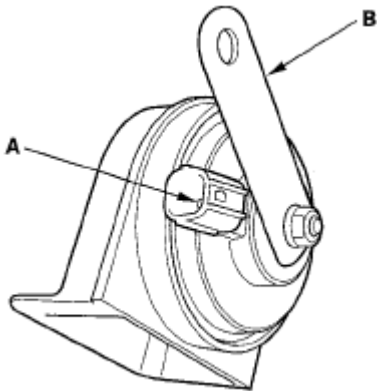


Fig. 4: Identifying Power Terminals And Grounding Bracket
Courtesy of AMERICAN HONDA MOTOR CO., INC.

4. If it fails to sound, replace it.

HORN SWITCH TEST

1. Remove the driver's dashboard undercover (see **DRIVER'S DASHBOARD UNDERCOVER REMOVAL/INSTALLATION**), and the driver's dashboard lower cover (see **DRIVER'S DASHBOARD LOWER COVER REMOVAL/INSTALLATION**), then remove the steering column covers (see **STEERING COLUMN REMOVAL AND INSTALLATION**).
2. Disconnect the 20P connector (A) from the cable reel (B).

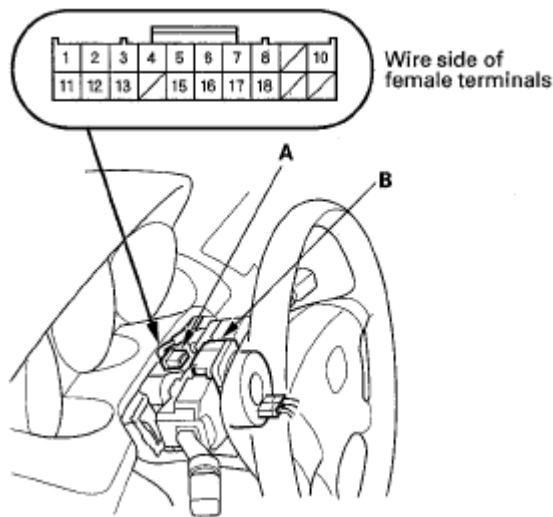


Fig. 5: Identifying Cable Reel And Horn 20P Connector
 Courtesy of AMERICAN HONDA MOTOR CO., INC.

3. Using a jumper wire, connect the No. 4 terminal of the dashboard wire harness (or combination switch wire harness)* 20P connector to body ground. The horns should sound.

*: '05 model

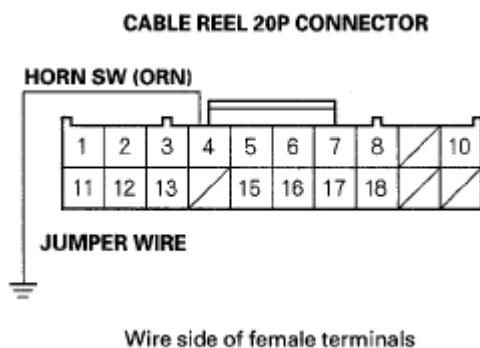


Fig. 6: Connecting No. 4 Terminal Of 20P Connector To Body Ground Using A Jumper Wire
 Courtesy of AMERICAN HONDA MOTOR CO., INC.

- If the horns sound, go to step 4.
 - If the horns don't sound, check these items:
 - No. 13 (15 A) fuse in the under-hood fuse/relay box
 - Relay control module in the under-hood fuse/relay box
 - Horns (see **HORN TEST/REPLACEMENT**)
 - An open in the wire
4. Reconnect the 20P connector (A) to the cable reel (B).

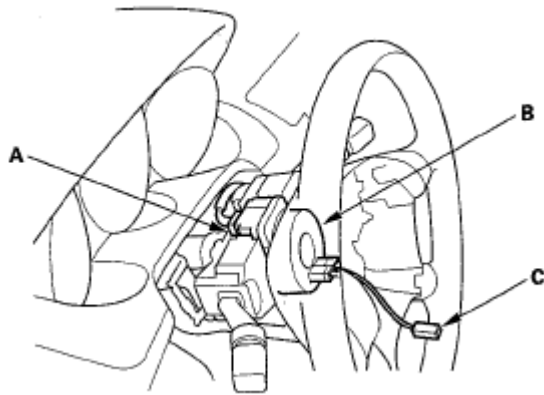


Fig. 7: Identifying Cable Reel And 20P Connector
 Courtesy of AMERICAN HONDA MOTOR CO., INC.

5. Remove the driver's airbag assembly (see **DRIVER'S AIRBAG REPLACEMENT**), and disconnect the horn switch 1P terminal (C) from the driver's airbag.
6. Check for continuity between the cable reel 20P connector No. 4 terminal and the horn switch 1P terminal. There should be continuity.
 - If there is continuity, check the installation of the driver's airbag assembly and the steering wheel. If OK, replace the driver's airbag assembly.
 - If there is no continuity, check these items:
 - Cable reel
 - An open in the wire

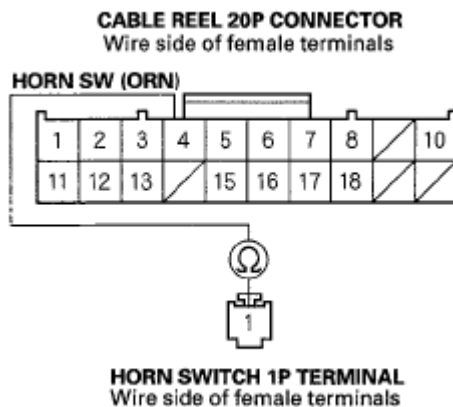


Fig. 8: Checking Continuity Between Cable Reel 20P Connector No. 4 Terminal And Horn Switch 1P Terminal
 Courtesy of AMERICAN HONDA MOTOR CO., INC.